



# Agilent U1250 Series Handheld Digital Multimeters

## Data Sheet

### Test more – more safely

The Agilent U1250 Series handheld digital multimeters (DMMs) exceed your expectations by delivering powerful features and performance that meet your toughest requirements and applications. The series' latest multimeters, the U1251B, U1252B and U1253B come in vivid orange cases, offering capabilities and functions equivalent to the U1250A Series.



#### Key features

- Superior contrast from organic LED (OLED) display<sup>1</sup>
- 50,000-count dual display
- Up to 0.025% basic DCV accuracy
- True-RMS AC and AC+DC<sup>2</sup> measurements
- K-type and J-type<sup>2</sup> temperature measurements
- Manual and automated (interval) data logging; internally to DMM and externally to PC
- CAT III 1000 V and CAT IV 600 V safety protection
- Built-in 20-MHz frequency counter<sup>2</sup>
- Built-in programmable square-wave generator<sup>2</sup>


[1] U1253A/U1253B model

[2] U1252A/U1252B/U1253A/U1253B models

#### Do more with just one instrument

The basic model, U1251A/U1251B, expands your capabilities beyond typical DMM measurements to include data logging. The U1252A/U1252B starts with the same foundation, and then adds a 20-MHz frequency counter and programmable square-wave generator — so you'd be able to perform more tests conveniently with one tool. What's more: both models come bundled with a complete set of accessories to equip you right from the start at no extra cost.

Offering the same functionality as the U1252A/U1252B, the U1253A/U1253B is the world's first OLED handheld DMM. You won't have to squint to be sure you're reading it right: On the go or on the bench, you'll get crystal-clear viewing indoors, even in dark, off-angle situations.

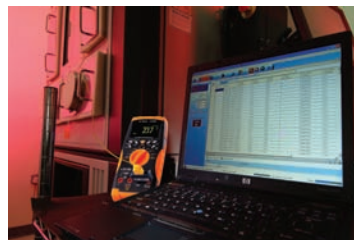

**Figure 1:** Automate recording of measurements with bundled GUI data-logging software.

#### Find problems quickly

Troubleshooting can be tricky, especially when you're dealing with elusive problems. With the U1250 Series' data logging capability, you can ensure that every reading gets recorded manually or at intervals you specify. Better yet: you can have virtually unlimited data logging saves when you connect any of the U1250 Series DMM to a PC with the optional IR-to-USB cable.

In addition, the U1250 Series lets you achieve greater confidence in your measurements with accurate true-RMS AC measurements, low DCV error rate of up to 0.025% and high-resolution display of 50,000 counts.

#### Uncompromising ruggedness and safety

The U1250 Series DMMs are housed in robust overmold enclosures, rated at CAT III 1000 V and CAT IV 600 V and operate over a wide temperature range of  $-20^{\circ}\text{C}$  to  $+55^{\circ}\text{C}$ . Each DMM also include a 30 kA high energy fuse to further protect you against violent fuse failures during high-current measurements. Built tough and certified to stringent industrial standards, the U1250 DMM is what you need to face the demands of everyday tasks.




Agilent Technologies

Take a closer look



OLED display with approximately 160° viewing angle, and high contrast ratio of 2000:1 for crystal-clear viewing <sup>1</sup>

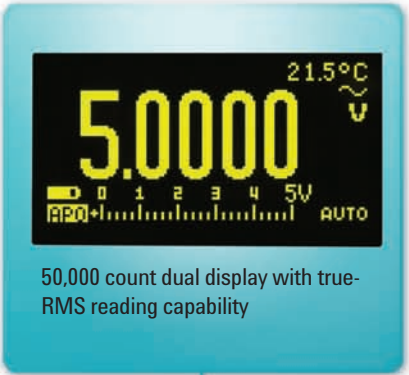

50,000 count dual display with true-RMS reading capability



SHIFT key and one-stop function keys for easy access

Broad range of measurement functions, including temperature and capacitance

Built-in battery charging for optimum capacity

20 MHz frequency counter <sup>2</sup>

Data logging to internal or external memory

Programmable square-wave generator for stimulation of digital circuits <sup>2</sup>

CAT III 1000 V and CAT IV 600 V overvoltage protection for assurance of your safety while you go about your tasks

Figure 2: U1253B front view

[1] U1253A/U1253B only

[2] U1252A/U1252B/U1253A/U1253B only

## DC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	TEST CURRENT/ BURDEN VOLTAGE	ACCURACY ± (% of reading + No. of Least Significant Digit)	
				U1251A/U1251B	U1252A/52B/53A/53B
VOLTAGE <sup>(1)</sup>	50.000 mV	0.001 mV	-	0.05 + 50 <sup>(2)</sup>	0.05 + 50 <sup>(2)</sup>
	500.00 mV	0.01 mV	-	0.03 + 5	0.025 + 5
	1000.0 mV	0.1 mV	-		
	5.0000 V	0.0001 V	-		
	50.000 V	0.001 V	-		
	500.00 V	0.01 V	-		
	1000.0 V	0.1 V	-	0.03 + 5	
RESISTANCE <sup>(8)</sup>	500.00 Ω <sup>(3)</sup>	0.01 Ω	1.04 mA	0.08 + 10	0.05 + 10
	5.0000 kΩ <sup>(3)</sup>	0.0001 kΩ	416 μA	0.08 + 5	0.05 + 5
	50.000 kΩ	0.001 kΩ	41.2 μA		
	500.00 kΩ	0.01 kΩ	4.12 μA		
	5.0000 MΩ	0.0001 MΩ	375 nA	0.2 + 5	0.15 + 5
	50.000 MΩ <sup>(4)</sup>	0.001 MΩ	187 nA	1 + 10	1 + 5
	500.00 MΩ <sup>(4)</sup>	0.01 MΩ	187 nA	N/A	3+10 < 200 MΩ / 8+10 > 200 MΩ
	500.00 nS <sup>(5)</sup>	0.01 nS	187 nA	1 + 20	1 + 10
CURRENT	500.00 μA	0.01 μA	0.06 V (100 Ω)	0.1 + 5 <sup>(6)</sup>	0.05 + 5 <sup>(6)</sup>
	5000.0 μA	0.1 μA	0.6 V (100 Ω)		
	50.000 mA	0.001 mA	0.09 V (1 Ω)	0.2 + 5 <sup>(6)</sup>	0.15 + 5 <sup>(6)</sup>
	440.00 mA	0.01 mA	0.9 V (1 Ω)		
	5.0000 A	0.0001 A	0.2 V (0.01 Ω)	0.3 + 10	0.3 + 10
	10.000 A <sup>(7)</sup>	0.001 A	0.4 V (0.01 Ω)		0.3 + 5
DIODE TEST <sup>(8)</sup>	-	0.1 mV	1.04 mA	0.05 + 5	

[1] Input impedance: Refer to Table A on page 8.

[2] The accuracy could be 0.05% + 10 for U1251A and 0.05% + 5 for U1252A/3A. Always use the NULL function to zero out the thermal effect before measuring the signal.

[3] The accuracy of 500 Ω and 5 kΩ is specified after NULL function, which is used to subtract the test lead resistance and the thermal effect.

[4] For the range of 50 MΩ and 500 MΩ, the R.H. is specified for <60%.

[5] The accuracy is specified for <50 nS and after NULL function with open test lead.

[6] Always use the NULL function to zero out thermal effect with open test lead before measuring the signal. If the NULL function is not used, an additional 20 counts needs to be added to the DC current accuracy. Thermal effect could occur due to the following:

- Wrong operation to measure the high voltage of 50 V ~ 1000 V for resistance, diode, and mV measurements.
- After battery-charging has completed.
- After measuring a current greater than 440 mA, it is suggested that the meter be left to cool down for twice the measuring time used.

[7] Current can be measured up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A~20 A for 30 seconds maximum. After measuring a current of > 10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.

[8] Maximum open voltage: <+ 4.2V.

## U1251A/U1251B AC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)			
			FREQUENCY			
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 30 kHz
TRUE RMS AC VOLTAGE <sup>(1) (2)</sup>	50.000 mV	0.001 mV	1.0+60	0.6+40	1.0+40	1.6+60
	500.00 mV	0.01 mV		0.6+25		
	1000.0 mV	0.1 mV				
	5.0000 V	0.0001 V			1.0+25	1.6+40
	50.000 V	0.001 V				
	500.00 V	0.01 V				
	1000.0 V	0.1 V		0.6+40	1.0+40	N/A

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)		
			FREQUENCY		
			30 Hz ~ 45 Hz	45 Hz ~ 2 kHz	2 kHz ~ 20 kHz
AC CURRENT <sup>[2]</sup>	500.00 µA <sup>[4]</sup>	0.01 µA	1.5+50	0.8+20	3.0+80
	5000.0 µA	0.1 µA	1.5+40		3.0+60
	50.000 mA	0.001 mA			
	440.00 mA	0.01 mA			
	5.0000 A	0.0001 A	2.0+40 <sup>[6]</sup>		3+60, <3 A/5 kHz
	10.000 A <sup>[5]</sup>	0.001 A			

### U1252A/U1252B/U1253A/U1253B AC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)					
			FREQUENCY					
			20 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 20 kHz	20 kHz~100 kHz <sup>[5]</sup>	
TRUE RMS AC VOLTAGE <sup>[1] [8]</sup>	50.000 mV	0.001 mV	1.5+60	0.4+40	0.7+40	0.75+40	3.5+120	
	500.00 mV	0.01 mV		0.4+25	0.4+25			
	1000.0 mV	0.1 mV						0.6+25
	5.0000 V	0.0001 V			0.4+25	1.5+40		
	50.000 V	0.001 V						0.4+40
	500.00 V	0.01 V		1.5+40 <sup>[3]</sup>	N/A			
	1000.0 V	0.1 V						

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)			
			FREQUENCY			
			20 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 20 kHz	20 kHz~100 kHz <sup>[7]</sup>
AC CURRENT <sup>[8]</sup>	500.00 µA <sup>[4]</sup>	0.01 µA	1.0+20	0.7+20	0.75+20	5.0+80
	5000.0 µA	0.1 µA				
	50.000 mA	0.001 mA			1.5+20	
	440.00 mA	0.01 mA				
	5.0000 A	0.0001 A	1.5+20 <sup>[6]</sup>	3+60, <3 A/5 kHz	N/A	
	10.000 A <sup>[5]</sup>	0.001 A				

[1] Input impedance: Refer to Table A on page 8.

[2] AC mV/V and AC µA/mA/A specifications are true RMS AC coupled, valid from 5% to 100% of range. The crest factor may be up to 3 at full scale, up to 5 at half-scale, except for 1000 mV and 1000 V ranges, where the crest factor is 1.5 at full scale and 3 at half scale.

[3] The input signal is lower than 20,000,000 V-Hz (the product of voltage and frequency).

[4] Input current >35 µArms.

[5] Current can be measured from 2.5 A up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A ~ 20 A for 30 seconds maximum. After measuring a current of >10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.

[6] Input current < 3 Arms.

[7] The additional error to be added as frequency >20 kHz and signal input <10% of range: 3 counts of LSD per kHz.

[8] Crest factor ≤ 3.0 at full scale, 5.0 at half scale except the 1000 mV and 1000 V ranges where it is 1.5 at full scale, 3.0 at half scale. For non-sinusoidal waveform, add 0.1% of reading ± 0.3% of range.

## U1252A/U1252B/U1253A/U1253B AC+DC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)				
			FREQUENCY				
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 20 kHz	20 kHz~100 kHz <sup>(3)</sup>
TRUE RMS AC VOLTAGE <sup>(1)</sup> <sup>(2)</sup>	50.000 mV	0.001 mV	1.5+80	0.4+60	0.7+60	0.8+60	3.5+220
	500.00 mV	0.01 mV	1.5+65	0.4+30	0.4+30	0.8+45	3.5+125
	1000.0 mV	0.1 mV			0.6+30	1.5+45	
	5.0000 V	0.0001 V					
	50.000 V	0.001 V			0.4+30	3.5+125 <sup>(4)</sup>	
	500.00 V	0.01 V					
	1000.00 V	0.1 V			0.4+45	0.4+45	1.5+45 <sup>(4)</sup>

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)		
			FREQUENCY		
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 20 kHz
AC CURRENT	500.00 µA <sup>(5)</sup>	0.01 µA	1.1+25	0.8+25	0.8+25
	5000.0 µA	0.1 µA			
	50.000 mA	0.001 mA	1.2+25	0.9+25	0.9+25
	440.00 mA	0.01 mA			
	5.0000 A	0.0001 A	1.8+30 <sup>(7)</sup>	0.9+30	3.3+70, <3 A/5 kHz
	10.000 A <sup>(6)</sup>	0.001 A		0.9+25	

## U1251A/U1251B/U1252A/U1252B TEMPERATURE SPECIFICATIONS

THERMOCOUPLE TYPE	RANGE		RESOLUTION	ACCURACY	
	°C	°F		°C	°F
K	-200 ~ 1372 °C	-328 ~ 2502 °F	0.1 °C/0.1 °F	0.3% + 3 °C	0.3% + 6 °F
J (for U1252A)	-210 ~ 1200 °C	-346 ~ 2192 °F	0.1 °C/0.1 °F	0.3% + 3 °C	0.3% + 6 °F

## U1253A/U1253B TEMPERATURE SPECIFICATIONS

THERMOCOUPLE TYPE	RANGE		RESOLUTION	ACCURACY	
	°C	°F		°C	°F
K	-200 ~ -40 °C	-104 ~ -40 °F	0.1 °C/0.1 °F	1% + 3 °C	1% + 5.4 °F
	-40 ~ 1372 °C	-40 ~ 2502 °F	0.1 °C /0.1 °F	1% + 1 °C	1% + 1.8 °F
J	-210 ~ -40 °C	-346 ~ -40 °F	0.1 °C /0.1 °F	1% + 3 °C	1% + 5.4 °F
	-40 ~ 1200 °C	-40 ~ 2192 °F	0.1 °C /0.1 °F	1% + 1 °C	1% + 1.8 °F

## CAPACITANCE SPECIFICATIONS

RANGE	RESOLUTION	ACCURACY	MEASURING RATE AT FULL SCALE	MAX. DISPLAY
10.000 nF	0.001 nF	1% + 8	4 times/sec.  1 time/sec. 0.1 times/sec. 0.01 times/sec	11000 counts
100.00 nF	0.01 nF	1% + 5		
1000.0 nF	0.1 nF			
10.000 µF	0.001 µF			
100.00 µF	0.01 µF			
1000.0 µF	0.1 µF			
10.000 mF	0.001 mF		3% + 10	
100.00 mF	0.01 mF			

## FREQUENCY SPECIFICATIONS<sup>[4]</sup>

RANGE	RESOLUTION	ACCURACY		MIN. INPUT FREQUENCY
		U1251A/2A	U1253A	
99.999 Hz	0.001 Hz	0.02%+3 <sup>[8]</sup>	0.02%+3 <sup>[8]</sup>	1 Hz
999.99 Hz	0.01 Hz	0.02%+3, <600 kHz	0.02%+3, <600 kHz	
9.9999 kHz	0.0001 kHz			
99.999 kHz	0.001 kHz			
999.99 kHz	0.01 kHz			

[1] Input impedance: Refer to Table A on page 8.

[2] Crest factor ≤ 3.0 at full scale, 5.0 at half scale except the 1000 mV and 1000 V ranges where it is 1.5 at full scale, 3.0 at half scale.  
For non-sinusoidal waveform, add 0.1% of reading ± 0.3% of range.

[3] The additional error to be added as frequency >20 kHz and signal input <10% of range: 3 counts of LSD per kHz.

[4] The input signal is lower than 20,000,000 V-Hz (the product of voltage and frequency).

[5] Input current >35 μArms.

[6] Current can be measured from 2.5 A up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A ~ 20 A for 30 seconds maximum. After measuring a current of >10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.

[7] Input current < 3 Arms.

[8] For non-square wave signals, add 5 counts.

## U1251A/U1251B FREQUENCY SENSITIVITY DURING VOLTAGE MEASUREMENT

FREQUENCY SENSITIVITY AND TRIGGER LEVEL				
INPUT RANGE	MINIMUM SENSITIVITY (R.M.S. Sine Wave)		TRIGGER LEVEL FOR DC COUPLING	
	20 Hz ~ 100 kHz	>100 kHz ~ 200 kHz	< 100 kHz	>100 kHz ~ 200 kHz
(Maximum input for specified accuracy = 10 x Range or 1000 V)				
50.000 mV	10 mV	15 mV	10 mV	15 mV
500.00 mV	25 mV	35 mV	60 mV	70 mV
1000.0 mV	40 mV	50 mV	100 mV	150 mV
5.0000 V	0.25 V	0.5 V	0.5 V / 1.25 V (< 100 Hz)	0.6 V
50.000 V	2.5 V	5 V	5 V	6 V
500.00 V	25 V	N/A	50 V	N/A
1000.0 V	50 V	N/A	300 V	N/A

## U1252A/U1252B/U1253A/U1253B FREQUENCY SENSITIVITY DURING VOLTAGE MEASUREMENT

FREQUENCY SENSITIVITY AND TRIGGER LEVEL				
INPUT RANGE	MINIMUM SENSITIVITY (R.M.S. Sine Wave)		TRIGGER LEVEL FOR DC COUPLING	
	20 Hz ~ 200 kHz	>200 kHz ~ 500 kHz	< 100 kHz	>100 kHz ~ 500 kHz
(Maximum input for specified accuracy = 10 x Range or 1000 V)				
50.000 mV	10 mV	25 mV	10 mV	25 mV
500.00 mV	70 mV	150 mV	70 mV	150 mV
1000.0 mV	120 mV	300 mV	120 mV	300 mV
5.0000 V	0.3 V	1.2 V	0.6 V	1.5 V
50.000 V	3 V	5 V	6 V	15 V
500.00 V	30 V < 100 kHz	N/A	60 V	N/A
1000.0 V	50 V < 100 kHz	N/A	120 V	N/A

## FREQUENCY SENSITIVITY DURING CURRENT MEASUREMENT

INPUT RANGE	MINIMUM SENSITIVITY (R.M.S. Sine Wave) 20 Hz ~ 20 kHz
500.00 $\mu$ A	100 $\mu$ A
5000.0 $\mu$ A	250 $\mu$ A
50.000 mA	10 mA
440.00 mA	25 mA
5.0000 A	1 A
10.000 A	2.5 A

## PEAK HOLD

SIGNAL WIDTH	ACCURACY FOR DC mV/VOLTAGE/CURRENT
Single event > 1 ms	2% + 400 for all ranges
Repetitive > 250 $\mu$ s	2% + 1000 for all ranges

## DUTY CYCLE AND PULSE WIDTH <sup>[1]</sup>

FUNCTION	MODE	RANGE	ACCURACY AT FULL SCALE
DUTY CYCLE	DC Coupling	0.01% ~ 99.99%	0.3% per kHz + 0.3%
PULSE WIDTH	500 ms	0.01 ms	0.2% + 3
	2000 ms	0.1 ms	0.2% + 3

[1] The positive or negative pulse width must be greater than 10  $\mu$ s, and the duty cycle range should be considered. The pulse width range is determined by the frequency of the signal.

## U1252A/U1252B/U1253A/U1253B FREQUENCY COUNTER SPECIFICATIONS

DIVISION	RANGE	RESOLUTION	ACCURACY $\pm$ (% of reading + No. of Least Significant Digit)		SENSITIVITY	MIN. INPUT FREQUENCY	MAXIMUM MEASUREMENT LEVEL
			U1252A	U1253A			
1 (secondary display "-1-")	99.999 Hz	0.001 Hz	0.02% + 3 <sup>[1]</sup>	0.02% + 3 <sup>[1]</sup>	100 mV R.M.S.	0.5 Hz	< 30 V <sub>pp</sub>
	999.99 Hz	0.01 Hz	0.002% + 5, <985 kHz	0.002% + 5, < 985 kHz			
	9.9999 kHz	0.0001 kHz					
	99.999 kHz	0.001 kHz					
	999.99 kHz	0.01 kHz	0.002% + 5, < 1 MHz	0.002% + 5, < 985 kHz	200 mV R.M.S.		
9.9999 MHz	0.0001 MHz						
100 (secondary display "-100-")	9.9999 MHz	0.0001 MHz	0.002% + 5, < 20 MHz	0.002% + 5, < 20 MHz	400 mV R.M.S.	1 MHz	
	99.999 MHz	0.001 MHz			600 mV R.M.S.		

## U1252A/U1252B/U1253A/U1253B SQUARE WAVE OUTPUT

OUTPUT <sup>[2]</sup>	RANGE	RESOLUTION	ACCURACY
FREQUENCY	0.5, 1, 2, 5, 6 <sup>[6]</sup> , 10, 15, 20, 25, 30, 40, 50, 60, 75, 80, 100, 120, 150, 200, 240, 300, 400, 480, 600, 800, 1200, 1600, 2400, 48000 Hz	0.01 Hz	0.005% + 2
DUTY CYCLE <sup>[3]</sup>	0.39% ~ 99.60%	0.390625%	0.4% of full scale <sup>[4]</sup>
PULSE WIDTH <sup>[4]</sup>	1/Frequency	Range/256	0.2 ms + Range/256
AMPLITUDE	Fixed 0 ~ +2.8 V	0.1 V	0.2 V

## MEASURING RATE

FUNCTION	TIMES/SECOND
ACV	7
ACV + dB	7
DCV	7
AC + DC V	2
$\Omega$ /nS	14
Diode	14
Capacitance	4 (< 100 $\mu$ F)
DCI	7
ACI	7
AC + DC I	2
Temperature	6
Frequency	1 (>10 Hz)
Duty cycle/Pulse width	0.5 (>10 Hz)

## MANUAL AND INTERVAL DATA LOGGING

LOGGING TYPE	MAXIMUM DATA POINTS <sup>[5]</sup>		
	U1251A	U1252A	U1253A
MANUAL	100	100	100
INTERVAL	200	200	1000

## DECIBEL (dB) CALCULATION

dB BASE	REFERENCE	DEFAULT REFERENCE
1 m $\Omega$ (dBm)	1-9999 $\Omega$	50 $\Omega$
1 V (dBV)	1 V	1 V

- [1] All frequency counters are susceptible to errors. Shielding inputs from external noise pickup is critical to minimize measurement errors. For non-square wave signals, add 5 counts.
- [2] Output impedance: 3.5 k $\Omega$  maximum.
- [3] The positive or negative pulse width must be greater than 50  $\mu$ s for adjustment of the duty cycle or pulse width under different frequencies. Otherwise, the accuracy and range will be different from the specifications defined.
- [4] For signal frequencies greater than 1 kHz, an addition of 0.1% per kHz is added to the accuracy.
- [5] For data logging to PC, maximum number of data points is dependent on available hard disk space.
- [6] For the U1253A/U1253B model.

## INPUT IMPEDANCE

Table A

FUNCTION	RANGE	INPUT IMPEDANCE
DC Voltage <sup>[1]</sup>	50.000 mV	10.00 M $\Omega$
	500.00 mV	10.00 M $\Omega$
	1000.0 mV	10.00 M $\Omega$
	5.0000 V	11.10 M $\Omega$
	50.000 V	10.10 M $\Omega$
	500.00 V	10.01 M $\Omega$
	1000.0 V	10.001 M $\Omega$
AC Voltage <sup>[2]</sup>	50.000 mV	10.00 M $\Omega$
	500.00 mV	10.00 M $\Omega$
	1000.0 mV	10.00 M $\Omega$
	5.0000 V	10.00 M $\Omega$
	50.000 V	10.00 M $\Omega$
	500.00 V	10.00 M $\Omega$
	1000.0 V	10.00 M $\Omega$
AC + DC Voltage <sup>[2]</sup>	50.000 mV	10.00 M $\Omega$
	500.00 mV	10.00 M $\Omega$
	1000.0 mV	10.00 M $\Omega$
	5.0000 V	11.10 M $\Omega$    10 M $\Omega$
	50.000 V	10.10 M $\Omega$    10 M $\Omega$
	500.00 V	10.01 M $\Omega$    10 M $\Omega$
	1000.0 V	10.001 M $\Omega$    10 M $\Omega$

- [1] For 5 V to 1000 V range, the specified input impedance in parallel with 10 M $\Omega$  at dual display.
- [2] The specified input impedance (nominal) in parallel with <100 pF.



## GENERAL SPECIFICATIONS

<p><b>DISPLAY</b></p> <p>Both primary and secondary displays are 5-digit on the LCD display. Both the primary and secondary displays offer a maximum resolution of 50,000 counts. Automatic polarity indication.</p>
<p><b>POWER CONSUMPTION</b></p> <p>105 mVA / 420 mVA (with backlight) maximum (U1251A/U1251B)  165 mVA / 480 mVA (with backlight) maximum (U1252A/U1252B)  420 mVA maximum (U1253A/U1253B)</p>
<p><b>BATTERY TYPE</b></p> <p>9 V Alkaline battery (ANSI/NEDA 1604A or IEC 6LR61)  9 V Carbon-zinc battery (ANSI/NEDA 1604D or IEC6F22)  7.2 V or 8.4 V Ni-MH Rechargeable battery</p>
<p><b>BATTERY LIFE</b></p> <p><b>U1251A/U1251B:</b> 72 hours typical  <b>U1252A/U1252B:</b> 36 hours typical  <b>U1253A/U1253B:</b> 8 hours typical</p>
<p><b>OPERATING ENVIRONMENT</b></p> <ul style="list-style-type: none"> <li>• Full accuracy at <math>-20\text{ }^{\circ}\text{C}</math> to <math>55\text{ }^{\circ}\text{C}</math> ; and to 80% RH for temperatures up to <math>35\text{ }^{\circ}\text{C}</math>, decreasing linearly to 50% RH at <math>55\text{ }^{\circ}\text{C}</math></li> <li>• 0 to 2000 m altitude per IEC 61010-1 2nd Edition CAT III, 1000 V / CAT IV, 600 V</li> </ul>
<p><b>STORAGE COMPLIANCE</b></p> <p><math>-40\text{ }^{\circ}\text{C}</math> to <math>70\text{ }^{\circ}\text{C}</math> with battery removed</p>
<p><b>SAFETY COMPLIANCE</b></p> <ul style="list-style-type: none"> <li>• IEC 61010-1:2001 / EN610101-1:2001</li> <li>• Canada: CSA C22.2 No. 61010-1:2004</li> </ul>
<p><b>MEASUREMENT CATEGORY</b></p> <p>CAT III 1000 V / CAT IV 600 V</p>
<p><b>EMC COMPLIANCE</b></p> <p>Certified to IEC/EN 61326: 2002, CISPR 11, and equivalents for Group 1, Class A</p>
<p><b>COMMON MODE REJECTION RATIO (CMRR)</b></p> <p><b>U1251A/U1251B/U1252A/U1252B:</b> <math>&gt;90\text{ dB}</math> at DC, 50/60 Hz <math>\pm 0.1\%</math> (1 k<math>\Omega</math> unbalanced)  <b>U1253A/U1253B:</b> <math>&gt;100\text{ dB}</math> at DC, 50/60 Hz <math>\pm 0.1\%</math> (1 k<math>\Omega</math> unbalanced)</p>
<p><b>NORMAL MODE REJECTION RATIO (NMRR)</b></p> <p><b>U1251A/U1251B/U1252A/U1252B:</b> <math>&gt;60\text{ dB}</math> at DC, 50/60 Hz <math>\pm 0.1\%</math>  <b>U1253A/U1253B:</b> <math>&gt;90\text{ dB}</math> at DC, 50/60 Hz <math>\pm 0.1\%</math></p>
<p><b>TEMPERATURE COEFFICIENT</b></p> <p>0.15 * (specified accuracy)/<math>^{\circ}\text{C}</math> (from <math>20\text{ }^{\circ}\text{C}</math> to <math>18\text{ }^{\circ}\text{C}</math> or <math>28\text{ }^{\circ}\text{C}</math> to <math>55\text{ }^{\circ}\text{C}</math>)</p>
<p><b>SHOCK and VIBRATION</b></p> <p>Tested to IEC/EN 60068-2</p>
<p><b>DIMENSIONS (HxWxD)</b></p> <p>203.5 mm x 94.4 mm x 59.0 mm</p>
<p><b>WEIGHT</b></p> <p><b>U1251A/U1251B:</b> 504<math>\pm</math>5 g with battery  <b>U1252A/U1252B/U1253A/U1253B:</b> 527<math>\pm</math>5 g with battery</p>
<p><b>CHARGING TIME (only U1252A/3A)</b></p> <p><math>&lt; 220</math> minutes approx. at the environment of <math>10\text{ }^{\circ}\text{C}</math> to <math>30\text{ }^{\circ}\text{C}</math></p>
<p><b>WARRANTY</b></p> <p>3 years for main unit  3 months for standard accessories unless otherwise specified.</p>

## ORDERING INFORMATION



## STANDARD SHIPPED ACCESSORIES

DESCRIPTION	APPLICABLE MODELS					
	U1251A	U1252A	U1253A	U1251B	U1252B	U1253B
Alligator clips	•	•	•	•	•	•
SMT grabbers	•	•	—	—	—	—
Fine-tip test probes	•	•	—	—	—	—
Test probe leads (4-mm)	•	•	•	•	•	•
Test probe leads (19-mm)	•	•	•	•	•	•
Mini grabber	•	•	—	—	—	—
Alkaline 9 V battery	•	—	—	•	—	—
Rechargeable Ni-MH battery with power adapter	—	•	•	—	•	•
Soft carrying case	•	•	—	—	—	—
Certificate of Calibration	•	•	•	•	•	•
Test Report	•	•	•	•	•	•
Quick Start Guide	•	•	•	•	•	•

### U1253A OPTION

**Option 001** Bundled SMT grabbers, fine-tip test probes and soft carrying case

## OPTIONAL ACCESSORIES

### MEASURING ACCESSORIES (NON-TEMPERATURE)



#### U1160A Standard test lead kit

Includes two test leads (red and black), alligator clips, fine-tip test probes, SMT grabbers and mini grabber (black).

- Test leads: CAT III 1000 V, 15 A
- Alligator clips: CAT III 1000 V, 10 A
- Fine-tip test probes: CAT II 300 V, 3 A
- SMT grabbers: CAT II 300 V, 3 A
- Mini grabber: CAT II 300 V, 3 A



#### U1161A Extended test lead kit

Includes two test leads (red and black), two test probes, medium-sized alligator clips and 4-mm banana plugs.

- Test leads: CAT III 1000 V, CAT IV 600 V, 15 A
- Test probes: CAT III 1000 V, 15 A
- Medium-sized alligator clips: CAT III 600 V, 10 A
- 4-mm banana plugs: CAT II 600 V, 10 A



#### U1162A Alligator clips

- One pair of insulated alligator clips (red and black). Recommended for use with Agilent standard test leads.
- Rated CAT III 1000 V, 10 A.



#### U1163A SMT grabbers

- One pair of SMT grabbers (red and black). Recommended for use with Agilent standard test leads.
- Rated CAT II 300 V, 3 A.



#### U1164A Fine-tip test probes

- One pair of fine-tip test probes (red and black). Recommended for use with Agilent standard test leads.
- Rated CAT II 300 V, 3 A.



#### U1165A Test probe leads

- Rated CAT III 1000 V, 15 A

### MEASURING ACCESSORIES (NON-TEMPERATURE)



#### U1168A Standard test lead kit

Includes two test leads (red and black), 19-mm and 4-mm test probes, alligator clips, fine-tip test probes, SMT grabbers and mini grabber (black).

- Test leads: CAT III 1000 V, CAT IV 600 V, 15 A
- Test probes (19-mm tip): CAT III 1000 V, CAT IV 600 V, 15 A
- Test probes (4-mm tip): CAT III 1000 V, CAT IV 600 V, 15 A (highly recommended for CAT IV environment)
- Alligator clips: CAT III 1000 V, 10 A
- Fine-tip test probes: CAT II 300 V, 3 A
- SMT grabber: CAT II 300 V, 3 A
- Mini grabber: CAT II 300 V, 3 A



#### U1169A Test probe leads

Includes two test leads (red and black), and a pair each of 19-mm and 4-mm test probes.

- Test leads: CAT III 1000 V, CAT IV 600 V, 15 A
- Test probes (19-mm tip): CAT III 1000 V, CAT IV 600 V, 15 A
- Test probes (4-mm tip): CAT III 1000 V, CAT IV 600 V, 15 A (highly recommended for CAT IV environment)



#### U1583B AC current clamp

- Dual range: 40 A and 400 A
- Rated CAT III 600 V
- BNC-to-banana-plug adapter provided for use with DMMs

### MEASURING ACCESSORIES (TEMPERATURE)



#### U1180A Thermocouple adapter+lead kit, J and K types

Includes thermocouple adapter, thermocouple bead J-type and thermocouple bead K-type.

- T/C adapter J/K-type
- T/C bead J-type: -20 °C to 200 °C
- T/C bead K-type: -20 °C to 200 °C



#### U1181A Immersion temperature probe

- Type-K T/C for use in oil and other liquids
- Measurement range: -50 °C to 700 °C
- Includes adapter U1184A for connection to DMM



#### U1182A Industrial surface temperature probe

- Type-K T/C for use on still surfaces
- Measurement range: -50 °C to 400 °C
- Includes adapter U1184A for connection to DMM



#### U1183A Air temperature probe

- Type-K T/C for use in air and non-caustic gas
- Measurement range: -50 °C to 800 °C
- Includes adapter U1184A for connection to DMM



#### U1184A Temperature probe adapter

- Mini-connector-to-banana-plug adapter for use with DMM



#### U1185A J-type thermocouple and adapter

- T/C adapter J/K-type
- T/C bead J-type: -20 °C to 200 °C

## MEASURING ACCESSORIES (TEMPERATURE)



### U1186A K-type thermocouple and adapter

- T/C adapter J/K-type
- T/C bead J-type: -20 °C to 200 °C

## CABLE



### U1173A IR-to-USB cable

- For remote control and data logging to PC
- Max. baud rate: 19,200 bits per second

## CARRYING CASE



### U1172A Transit case (aluminium-clad)

The robust casing to transport your DMM and accessories

- Aluminum-clad, black panel construction
- Dimension: 18" (H) x 13" (W) x 6" (D)
- Weight: 4 kg



### U1174A Soft carrying case

The convenient way to carry your DMM and essential accessories

- Dimension: 9" (H) x 5" (W) x 3" (D)

## HANGING KIT



### U1171A Magnetic hanging kit

For fastening of DMM to a steel surface so both hands are free.

## AC ADAPTOR



### U1170A AC adaptor

Includes AC power cord based on country



### Agilent Email Updates

[www.agilent.com/find/emailupdates](http://www.agilent.com/find/emailupdates)

Get the latest information on the products and applications you select.



[www.lxistandard.org](http://www.lxistandard.org)

LXI is the LAN-based successor to GPIB, providing faster, more efficient connectivity. Agilent is a founding member of the LXI consortium.

### Agilent Channel Partners

[www.agilent.com/find/channelpartners](http://www.agilent.com/find/channelpartners)

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.

## Remove all doubt

Our repair and calibration services will get your equipment back to you, performing like new, when promised. You will get full value out of your Agilent equipment throughout its lifetime. Your equipment will be serviced by Agilent-trained technicians using the latest factory calibration procedures, automated repair diagnostics and genuine parts. You will always have the utmost confidence in your measurements. For information regarding self maintenance of this product, please contact your Agilent office.

Agilent offers a wide range of additional expert test and measurement services for your equipment, including initial start-up assistance, onsite education and training, as well as design, system integration, and project management.

For more information on repair and calibration services, go to:

[www.agilent.com/find/removealldoubt](http://www.agilent.com/find/removealldoubt)

[www.agilent.com](http://www.agilent.com)

[www.agilent.com/find/handheldmm](http://www.agilent.com/find/handheldmm)

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

[www.agilent.com/find/contactus](http://www.agilent.com/find/contactus)

### Americas

Canada	(877) 894 4414
Latin America	305 269 7500
United States	(800) 829 4444

### Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Thailand	1 800 226 008

### Europe & Middle East

Austria	43 (0) 1 360 277 1571
Belgium	32 (0) 2 404 93 40
Denmark	45 70 13 15 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
Switzerland	0800 80 53 53
United Kingdom	44 (0) 118 9276201

Other European Countries:

[www.agilent.com/find/contactus](http://www.agilent.com/find/contactus)

Revised: October 1, 2009

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2009  
Printed in USA, November 25, 2009  
5989-5509EN



Agilent Technologies

# Agilent U1177A IR-to-Bluetooth Adapter

## Data Sheet

### Features

- Enables Bluetooth® connection to Agilent handheld digital multimeters
- Easy to install by attaching to Infrared (IR) port located at the back of Agilent handheld digital multimeters
- Compatible with Agilent U1230 series, U1240 series, U1250 series and U1270 series handheld digital multimeters
- Operated by two 1.5 V AAA batteries

*The Bluetooth® word mark and logos are registered trademark owned by Bluetooth SIG, Inc and any use of such marks by Agilent Technologies, Inc. is under license. Other trademark and trade names are those of their respective owners.*

Agilent U1177A Infrared (IR)-to-Bluetooth® adapter offers wireless remote connectivity solution via Bluetooth® connection simply by attaching the adapter to the IR port of an Agilent handheld digital multimeter. The wireless remote connectivity is set up when an Agilent handheld digital multimeter is connected to U1177A and an Android device (tablet or smart phone) with the installed software. Every U1177A also has a unique Media Access Control (MAC) address. User can quickly and easily scan for the right U1177A using their Android device and pair up with the U1177A.

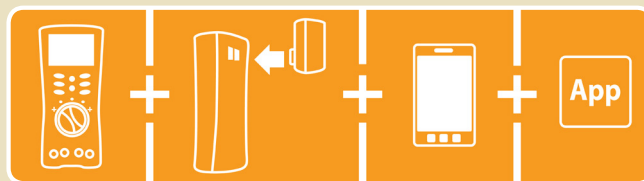


Figure 1. Agilent wireless remote connectivity solution





Take a closer look

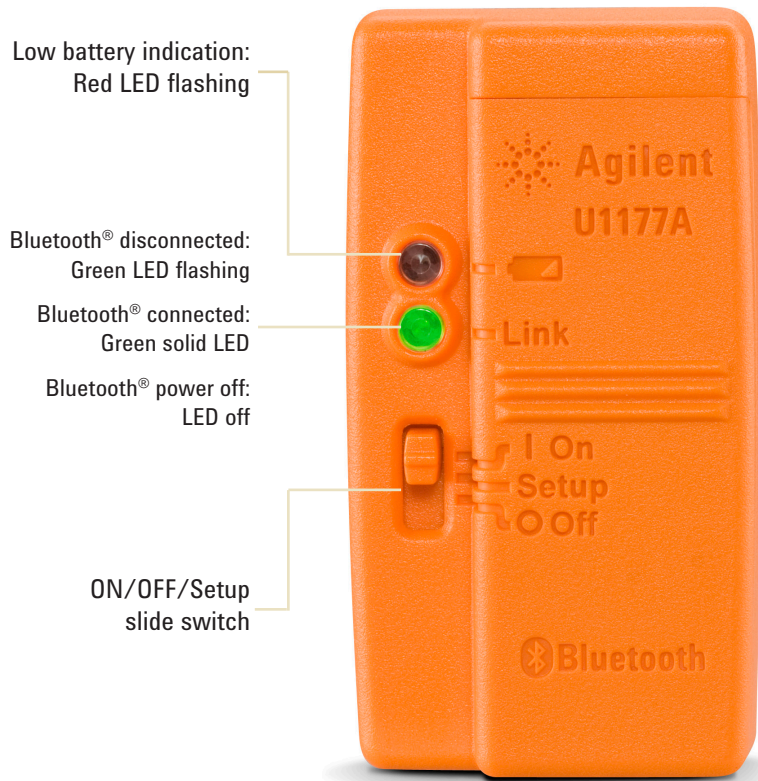


Figure 2. The U1177A as illustrated

## Perform data logging with multimeters – wirelessly!



Figure 3. Data logging with Agilent Mobile Logger software.

Data logging is an important function for industrial users to capture data streams or plotting trending graphs. These data and graphs are used for analysis to identify intermittent behavior or detect drifts. Agilent Mobile Logger is the free Android application software that logs data and provides trending graphs from Agilent handheld digital multimeters. Agilent Mobile Logger offers an array of extended functions such as sending e-mail or Short Message Service (SMS) automatically, and pan and zoom function via the Android device's touch screen. Alternatively, data logging and monitoring activities can also be performed at the comfort of one's Personal Computer (PC) via a downloadable Agilent GUI data logger software.

### Notes:

1. Agilent Mobile Meter and Agilent Mobile Logger can be downloaded from [www.agilent.com/find/hh-Android](http://www.agilent.com/find/hh-Android) or from Android Market (<https://market.android.com/>)
2. Agilent GUI Data Logger Software can be [www.agilent.com/find/hh-logger](http://www.agilent.com/find/hh-logger)

## Perform up to three multimeter measurements at the same time with Agilent Mobile Meter

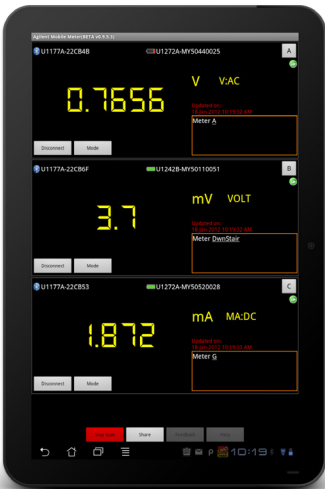


Figure 4. Up to three multimeters measurements with the Agilent Mobile Meter

Agilent Mobile Meter is a free Android application software that allows an Android device to connect, control and perform up to 3 multimeter measurements. Without the need to be physically present at various points, users can now extend their reach to two or three places. This solution allows you to make measurements from a safe distance, eliminates the need to walk back-and-forth between measure target and control points, and monitors multiple measurements simultaneously. Achieve higher work productivity when you use the U1177A with your Agilent handheld digital multimeters.

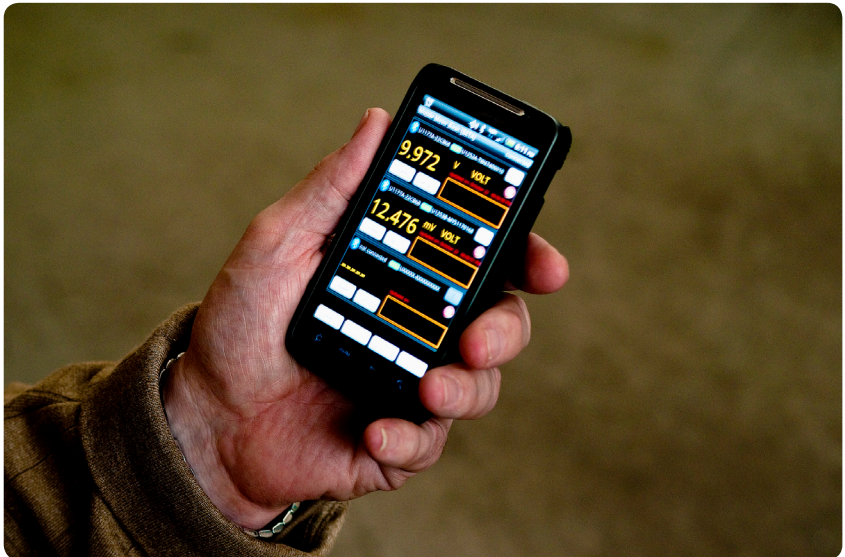


Figure 5. Make measurements with the Agilent Mobile Meter via an Android smart phone



# Specifications

Product characteristics	Description
Radio specification	<ul style="list-style-type: none"> <li>• Frequency: 2402 MHz ~ 2480 MHz</li> <li>• Antenna Power: 1 mW or less</li> <li>• Number of Channels: 79</li> <li>• Modulation: GFSK / PSK</li> </ul>
Operating environment	Operating temperature from –20 to 55 °C
Storage environment	Storage temperature from –40 to 70 °C
Relative humidity (R.H.)	Relative humidity up to 95% at 40 °C (non-condensing)
Power consumption	Maximum 130 mVA for two 1.5 V AAA batteries
Battery life	30 hours typical (based on continuous data transfer)
Battery type	Alkaline 24 A (ANSI/NEDA) and LR03 (IEC), or Zinc Chloride 24 D (ANSI/NEDA) and R03 (IEC)
Dimension (W x H x L)	39.0 × 71.0 × 37.0 mm
Weight	60 g with batteries
Warranty	Three months
Bluetooth	<b>"Bluetooth"</b> Version 2.1 + EDR compliant, SPP profile, Class 2 device (with 10 metres connection range)
Safety	<p>The U1177A complies with the requirements of the following safety and regulation standards:</p> <ul style="list-style-type: none"> <li>• FCC Part15C (Certification) (15.209, 15.247) FCC ID: ZKMAGILENT-U1177A</li> <li>• FCC Part15B (DoC) (15.109)</li> <li>• RSS–210 Issue 8:2010 IC: 6310A–U1177A</li> <li>• ICES–003 Issue 4:2004</li> <li>• EN 300 328 V1.7.1:2008</li> <li>• EN 301 489–1V1.8.1:2008/–17 V2.11:2009</li> <li>• EN 55022:2006+A1:2007/EN55024:1998+A1:2001+A2:2003</li> <li>• EN 50371:2002</li> <li>• EN 60950–1:2006/A11:2009/A1:2010</li> <li>• Complies with IDA Standards (DB 102425)</li> <li>• India Equipment Type Approval (ETA) Certificate No: 1424/2011/WRLO</li> <li>• COFETEL Certificate No: RCPAGU111-1066, registered under Agilent Technologies Mexico S de RL de CV</li> </ul> <p>"This telecommunication equipment conforms NTC technical requirement"</p>



## Standard shipped items:

- Two 1.5 V AAA batteries
- Operating instructions



### Agilent Email Updates

[www.agilent.com/find/emailupdates](http://www.agilent.com/find/emailupdates)

Get the latest information on the products and applications you select.



[www.axistandard.org](http://www.axistandard.org)

AdvancedTCA® Extensions for Instrumentation and Test (AXIe) is an open standard that extends the AdvancedTCA for general purpose and semiconductor test. Agilent is a founding member of the AXIe consortium.



[www.lxistandard.org](http://www.lxistandard.org)

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Agilent is a founding member of the LXI consortium.



[www.pxisa.org](http://www.pxisa.org)

PCI eXtensions for Instrumentation (PXI) modular instrumentation delivers a rugged, PC-based high-performance measurement and automation system.

### Agilent Channel Partners

[www.agilent.com/find/channelpartners](http://www.agilent.com/find/channelpartners)

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.



Agilent Advantage Services is committed to your success throughout your equipment's lifetime. To keep you competitive, we continually invest in tools and processes that speed up calibration and repair and reduce your cost of ownership. You can also use Infoline Web Services to manage equipment and services more effectively. By sharing our measurement and service expertise, we help you create the products that change our world.

[www.agilent.com/find/advantageservices](http://www.agilent.com/find/advantageservices)



[www.agilent.com/quality](http://www.agilent.com/quality)

[www.agilent.com](http://www.agilent.com)  
[www.agilent.com/find/U1177A](http://www.agilent.com/find/U1177A)

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

[www.agilent.com/find/contactus](http://www.agilent.com/find/contactus)

#### Americas

Canada	(877) 894 4414
Brazil	(11) 4197 3600
Mexico	01800 5064 800
United States	(800) 829 4444

#### Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

#### Europe & Middle East

Belgium	32 (0) 2 404 93 40
Denmark	45 45 80 12 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
	*0.125 €/minute
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
United Kingdom	44 (0) 118 927 6201

For other unlisted countries:

[www.agilent.com/find/contactus](http://www.agilent.com/find/contactus)

Revised: January 6, 2012

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2012  
Published in USA, February 2, 2012  
5990-9531EN



**Agilent Technologies**