


SKU:DRI0002 (<https://www.dfrobot.com/product-66.html>)

Introduction

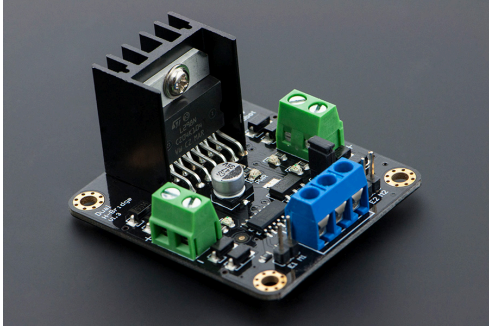


(<https://www.dfrobot.com/product-66.html>)

This is a 4.8-46V, 2A Dual Motor Controller which is the revised version of the DF-MDV1.0. Its performance has been improved greatly. It can bear larger current due to the increased haetsink dissipation. It is easy to control, using LGS's outstanding high-power motor driver chip, the L298N. This chip allows for direct drive of two bi-directional DC motors, and incorporates high-speed short diodes for protection. Drive current up to 2A per motor output. The driver uses a broad-brush design to reduce wire resistance.

Specifications

- The logic part of the input voltage: 6 ~ 12V
- Driven part of the input voltage V_s : 4.8 ~ 46V
- The logical part of the work current I_{ss} : 36mA
- Drive part of the operating current I_o : 2A
- Maximum power dissipation: 25W ($T = 75$ degree Celsius)
- Control signal input level:
- High level: $2.3V = V_{in} = V_{ss}$
- Low: $-0.3V = V_{in} = 1.5V$
- Operating temperature: -25 degree Celsius ~ $+130$ degree Celsius
- Drive Type: Dual high-power H-bridge driver
- Module Size: 47 mm × 53mm
- Module Weight: About 29g

Board Overview

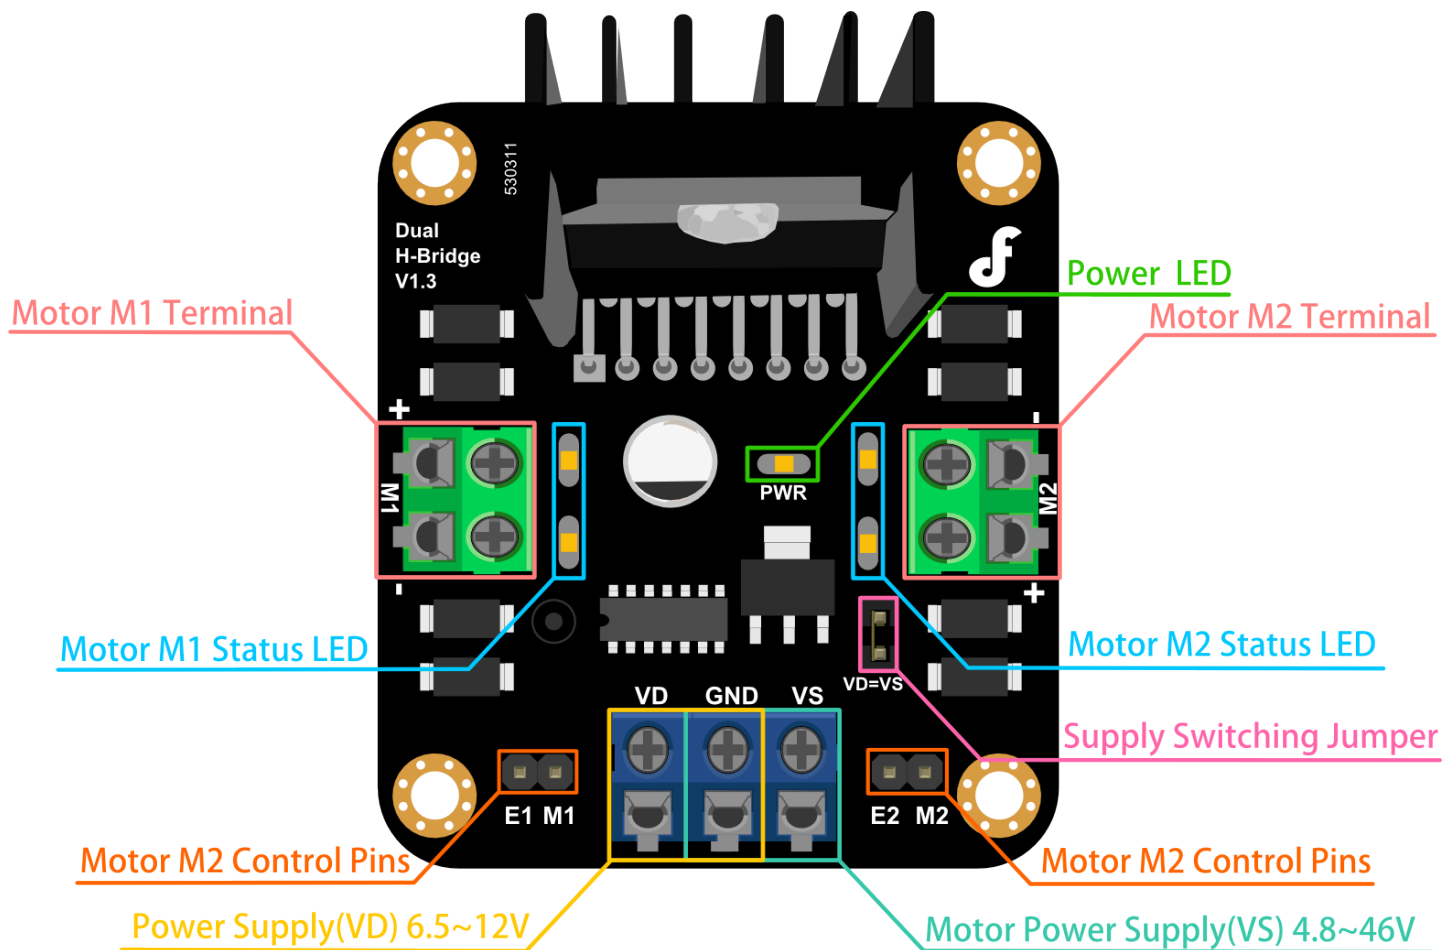

Detailed Descriptions

Motor Terminal

The terminals are used to connected to the motors, which labeled "+" and "-" representing motor polarity.

LED

- PWM: Power LED
- Motor Status LED: Motors work normally, thus the LED will light up.

Power



- VD: Power Supply 6.5V~12V;
- VS: Motor Power Supply 4.8 ~ 46V;

- GND: The common ground of Logic Power Supply and Motor Supply

Supply Switching Jumper



When jumper is shorted, logic power supply voltage is the same as the motor power supply. If motor power supply is less than 12V, you can set jumper shorted. **If motor power supply is more than 12V, don't short jumper!**

Motor Control Pins

- E1,E2: Motor Enable Pin (PWM Control)
- M1,M2: Motor Signal Pin. Eg: M1 = 0,the motor rotates in forward direction. M1 = 1,the motor rotates in back direction.


E	M	RUN
LOW	LOW/HIGH	STOP
HIGH	HIGH	Back Direction
HIGH	LOW	Forward direction
PWM	LOW/HIGH	Speed


Note: LOW = 0; HIGH = 1; PWM = 0~255

Tutorial

This tutorial shows you how to use I298N motor drive shield to drive two DC motors.

Connection Diagram

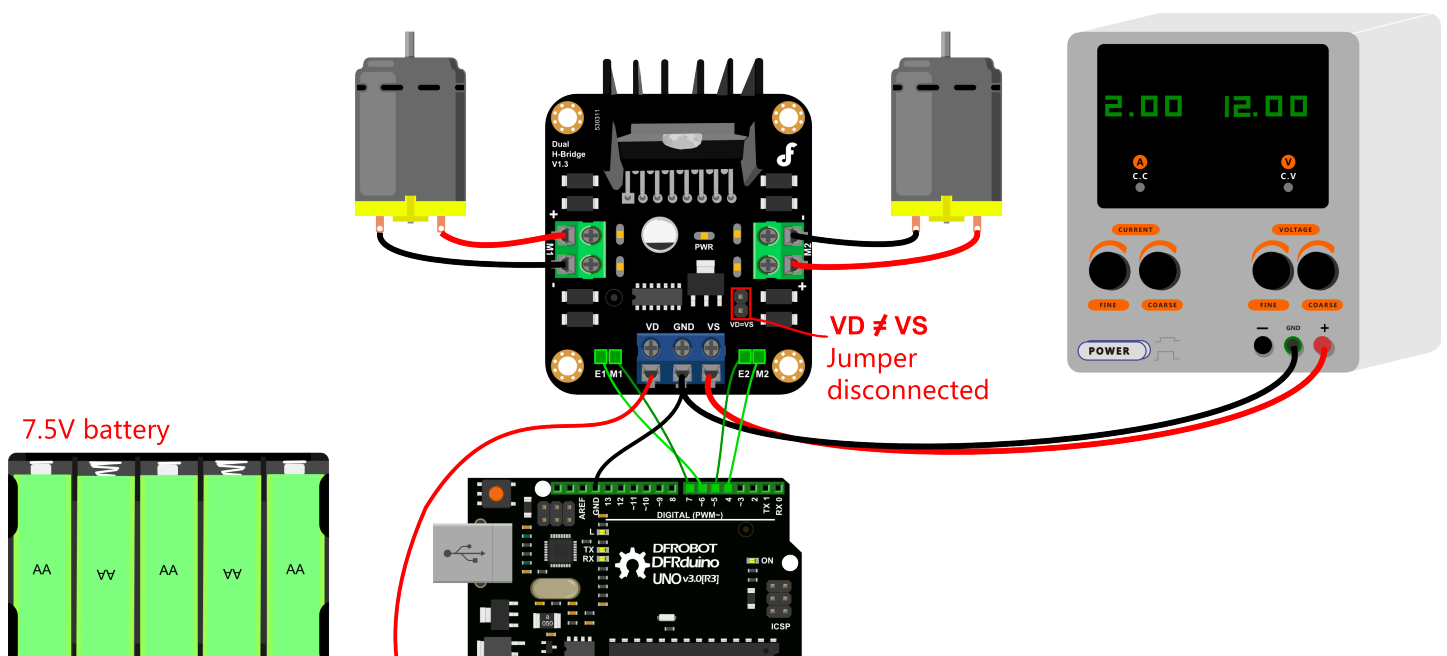

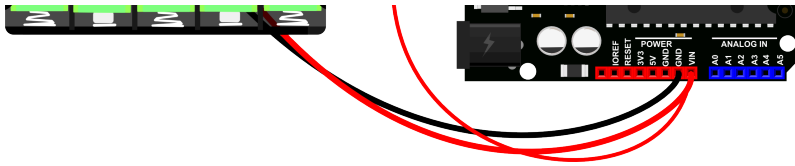

Sample Code

```
// # Editor      : Lauren from DFRobot
// # Date       : 17.02.2012

// # Product name: L298N motor driver module DF-MD v1.3
// # Product SKU : DRI0002
// # Version    : 1.0

// # Description:
// # The sketch for using the motor driver L298N
// # Run with the PWM mode

// # Connection:
// #      M1 pin  -> Digital pin 4
// #      E1 pin  -> Digital pin 5
// #      M2 pin  -> Digital pin 7
// #      E2 pin  -> Digital pin 6
// #      Motor Power Supply -> Centor blue screw connector(5.08mm 3p connector)
// #      Motor A  -> Screw terminal close to E1 driver pin
// #      Motor B  -> Screw terminal close to E2 driver pin
// #
// # Note: You should connect the GND pin from the DF-MD v1.3 to your MCU controller. They should share the GND pins
// #




int E1 = 6;
int M1 = 7;
int E2 = 5;
int M2 = 4;

void setup()
{
  pinMode(M1, OUTPUT);
  pinMode(M2, OUTPUT);
}

void loop()
{
  int value;
  for(value = 0 ; value <= 255; value+=5)
  {
    digitalWrite(M1,HIGH);
    digitalWrite(M2,HIGH);
    analogWrite(E1, value); //PWM Speed Control
    analogWrite(E2, value); //PWM Speed Control
    delay(30);
  }
}
```

PWM Principle

$$\text{output_voltage} = (\text{on_time} / \text{off_time}) * \text{max_voltage}$$

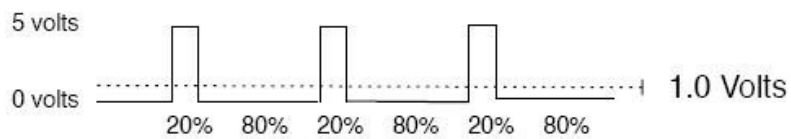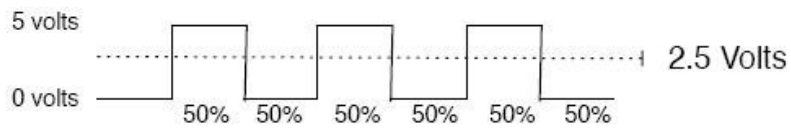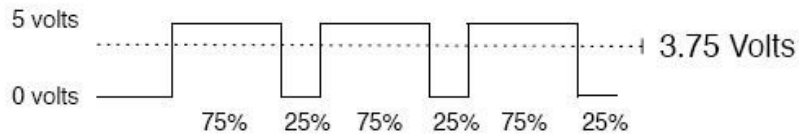

FAQ

Q&A	Some general Arduino Problems/FAQ/Tips
A	For any questions, advice or cool ideas to share, please visit the DFRobot Forum (https://www.dfrobot.com/forum/).

More Documents

DRI0002-SCH (<https://dfimg.dfrobot.com/5d09937f437c63049d98b469/wiki/264fca5d920398dbabccbfdd0e07fb88.PDF>)